



## WELDING PROCEDURE SPECIFICATION

**WPS -** 2010/1000-1      **REV. NO.:** 1      **DATE:** 7/20/2005      **\*\*APPLICABILITY\*\***  
**WELDING PROCESS:** GTAW      and SMAW-      **ASME:** X      **AWS:** X      **OTHER:**  
**SUPPORTING PQR:** Z-WS-3(X-X)      Z-WS-4(X-X)      P-WS-233      P-WS-227-1      P-WS-227-2  
    1-2-GTSM-1-1      P-WS-171-1

**JOINT:** This WPS shall be used in conjunction with the General Welding Standards (GWS) and Welding Fabrication Procedure (WFP) sections and criteria for joint details, repairs, NDE, inspection etc.

<b>Weld Joint Type:</b> Butt/Fillet	<b>Class:</b>	Full or Partial Penetration
<b>See GWS 1-06 and WFP's for joint details</b>	<b>Preparation:</b>	Thermal/Mechanical
<b>Root Opening:</b> 1/16 - 3/16	<b>Backing:</b>	Strap, ring or backweld
<b>Backgrind root:</b> On double sided joints	<b>Backing Mat.:</b>	CS strap/ring when used
<b>Bkgrd Method:</b> Grind or arc gouge	<b>GTAW Flux:</b> N/A	<b>Backing Retainer:</b> N/A

<b>FILLER METALS</b>		<b>Class:</b>	ER70S-X	<b>and</b>	E7018
<b>A No:</b> 1	<b>SFA Class:</b> 5.18 and 5.1	<b>F No:</b> 6 and 4	<b>Size:</b> 1/16	3/32	1/8      5/32
<b>Insert:</b> N/A <b>Insert Desc.:</b> N/A		<b>Weld Metal Thickness Ranges:</b>			
<b>Flux:</b> Type: NA	<b>Size:</b> 0	<b>AWS Root Pass:</b>	0.035	<b>thru</b>	0.436
<b>Filler Metal Note:</b> For SMAW no pass shall be >1/2"		<b>AWS Balance:</b>	0.035	<b>thru</b>	1.500
		<b>ASME Root Pass:</b>	0.035	<b>thru</b>	0.436
		<b>ASME Balance:</b>	0.035	<b>thru</b>	1.500

<b>BASE MATERIAL</b>	<b>P No.</b> 1	<b>Gr No.</b> All	<b>to:</b> P No. 1	<b>Gr No.</b> All
<b>Spec.</b> Mild Steel	<b>Grade:</b> All	<b>to:</b> Spec. Mild Steel	<b>Grade:</b> All	
<b>Qualified Pipe Dia. Range:</b> ≥	<b>AWS:</b> 24	<b>ASME:</b> 2.5		
<b>Qualified Thickness Range:</b>	<b>AWS:</b> 0.035	<b>thru</b> 1.500	<b>ASME:</b> 0.035	<b>thru</b> 1.500

**QUALIFIED POSITIONS:**      **AWS:** All      **ASME:** All      **Vert. Prog.:**      V/Up

<b>Preheat Min. Temp.:</b> 70 °F	<b>GAS: Shielding:</b> Argon	<b>or</b>	
<b>Interpass Max. Temp.:</b> 500 °F	<b>Gas Composition:</b> 100 / 0 / 0 %		0 / 0 / %
<b>Preheat Maintenance:</b> 70 °F	<b>Gas Flow Rate cfh:</b> 10	<b>to</b> 25	0 <b>to</b> 0
<b>PWHT: Time @ °F Temp.</b> 0	<b>Backing Gas/Comp:</b> N/A		0 %
<b>Temp. Range:</b> 0 °F	<b>Backing Gas Flow cfh:</b> 0	<b>to</b> 0	
<b>to</b> 0 °F	<b>Trailing Gas/Comp:</b> N/A		0 %

**APPROVAL:**      Signatures on file at ENG

**DATE:**      7/20/2005

**WELDING CHARACTERISTICS:**

**Current:** DCEP and DCEN      **Tungsten Type:** ETHW-2      **Transfer Mode:** Manual  
**Ranges: Amps** 35 to      **Tungsten Dia.:**      **Pulsing Cycle:** 0 to 0  
**Volts** to      **Background Current:** 0  
**Fuel Gas:** N/A      **Flame:** N/A      **Braze temp. °F** 0 to 0

**WELDING TECHNIQUE:** For fabrication specific requirements such as fittup, cleaning, grinding, PWHT and inspection criteria refer to Volume 2, Welding Fabrication

**Technique:** Manual      **Cleaning Method:** Wire Brush, File, Grind, Chip  
**Single Pass or Multi Pass:** M      **Stringer or Weave bead (S/W):** S/W      **Oscillation:** N  
**GMAW Gun Angle °:** 0 to 0      **Forehand or Backhand for GMAW (F/B):** N/A  
**GMAW/FCAW Tube to work distance:** 0  
**Maximum K/J Heat Input:** 0      **Travel speed:** Variable      **Gas Cup Size:** #3 - 6

**PROCEDURE QUALIFIED FOR:**

**Charpy "V" Notch:** N/A      **Nil-Ductil Transition Temperature:** N/A      **Dynamic Tear:** N/A

**Comments:** Various PQRs with base material ranging from .035 (20 Gage) to .750 plate and 6" Sch. 80 (.432) pipe constitute the basis of this multi-process WPS.

Weld Layer	Manual Process	Filler Metals	Size	Amp Range	Volt Range	Travel/ipm	Nozzel Angle	Other
1	GTAW	ER70S-X	1/16	35 to 95	to	to	0 to 0	
2	SMAW-	E7018	3/32	70 to 95	to	to		
3	SMAW-	E7018	1/8	125 to 160	to	to		
4	SMAW-	E7018	5/32	140 to 205	to	to		
5								
6								

**REM.** \* Weld layers are representative only - actual number of passes and layer sequence may vary due to variations in joint design, thickness and fitup.

Use of LANL Welding Procedures and Welder Qualifications for non-LANL work shall be at the sole risk and responsibility of the Subcontractor, and the Subcontractor shall indemnify and save LANL and the Government harmless from any and all claims, demands, actions or causes of action, and for any expense or loss by reason of Subcontractor's and their employees possession and use of LANL procedures and qualifications.